


Leonid C. Lev General Motors R&D

March 1, 2012 Houston, TX

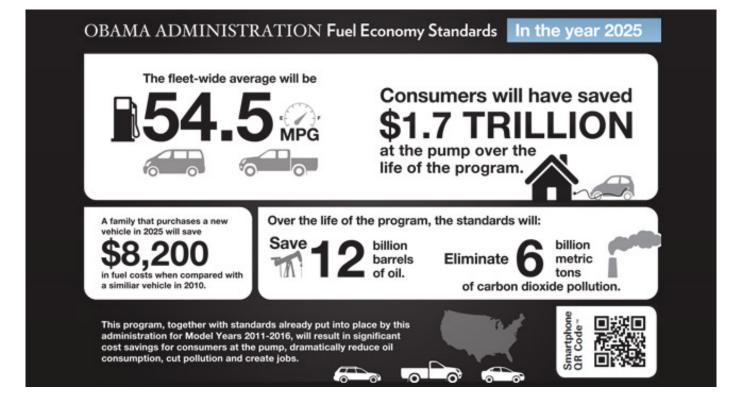



Future of Automotive Transportation





Future of Automotive Manufacturing

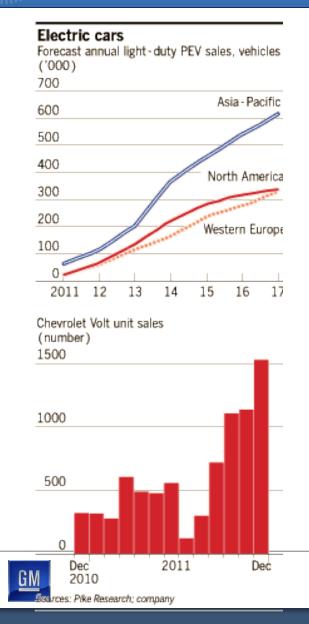

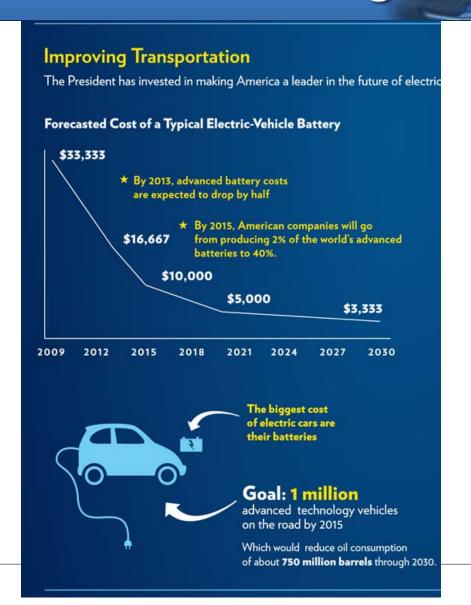


Future of Automotive Powertrain Technology: Chevy Volt

"The 2011 Chevrolet Volt is in the vanguard of the auto industry's shift from the petroleum-based model...to the electrified model.

With its new Voltec propulsion system, GM…brings a unique approach…" [SAE, 2011]




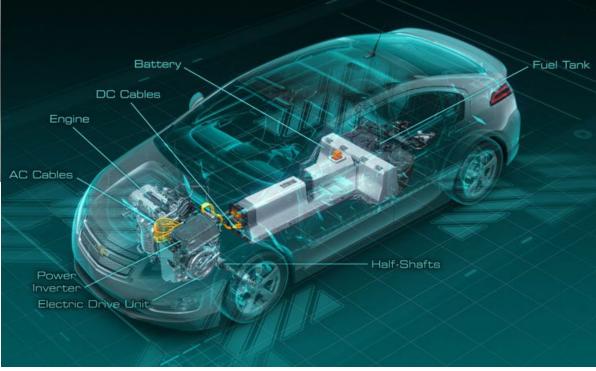



Voltec Powertrain



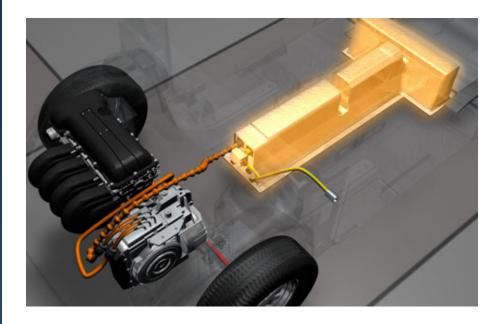





The hart of Voltec powertrain: Li-ion Battery






Voltec Battery Design

TAIL BY

Battery Pack – Basic Construction

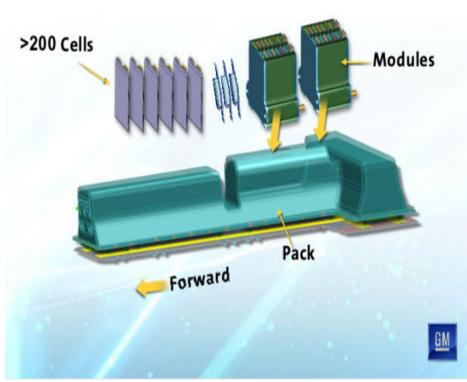




Battery Management System



Automotive Li-ion Battery "Cell"






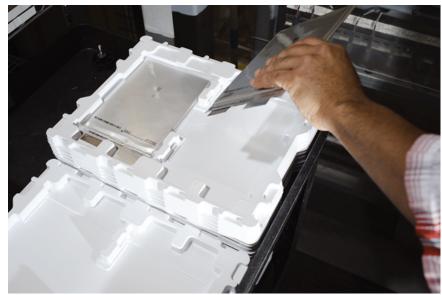

Courtesy MIT TechReview




Battery Assembly: Stacking Operation

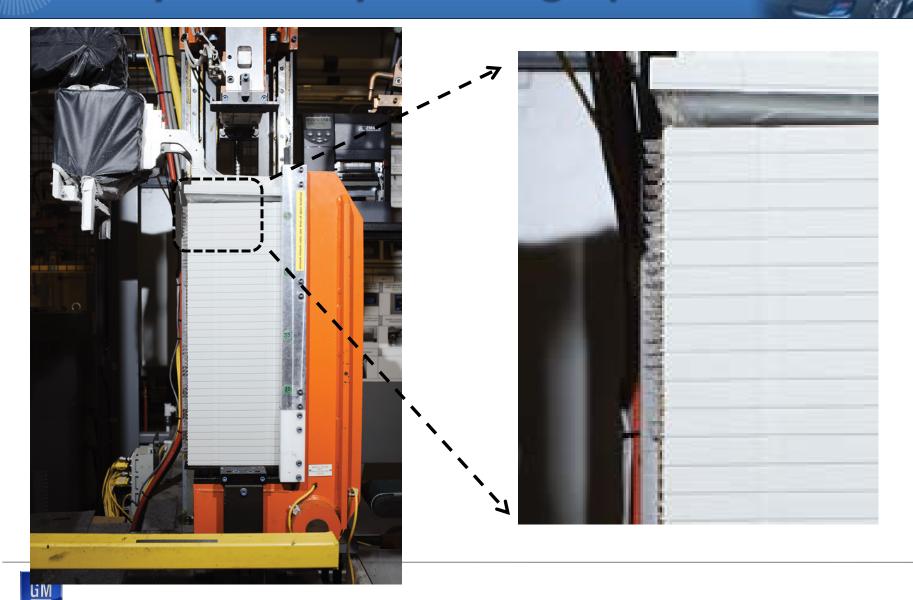

Assembled Battery Pack






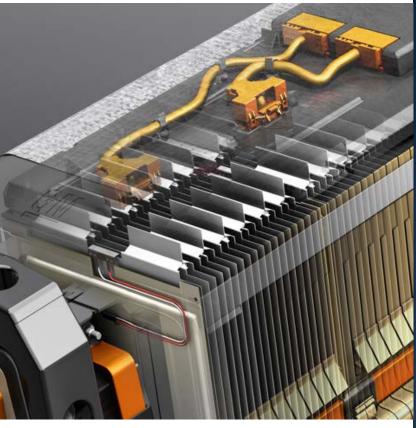




Installation of Interconnects



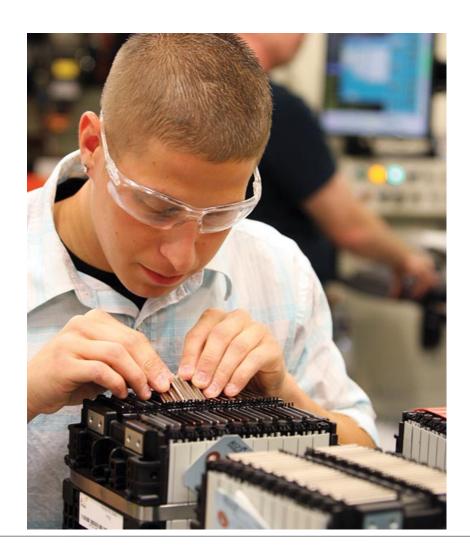



Ultrasonic Welding Is Used for Battery Assembly

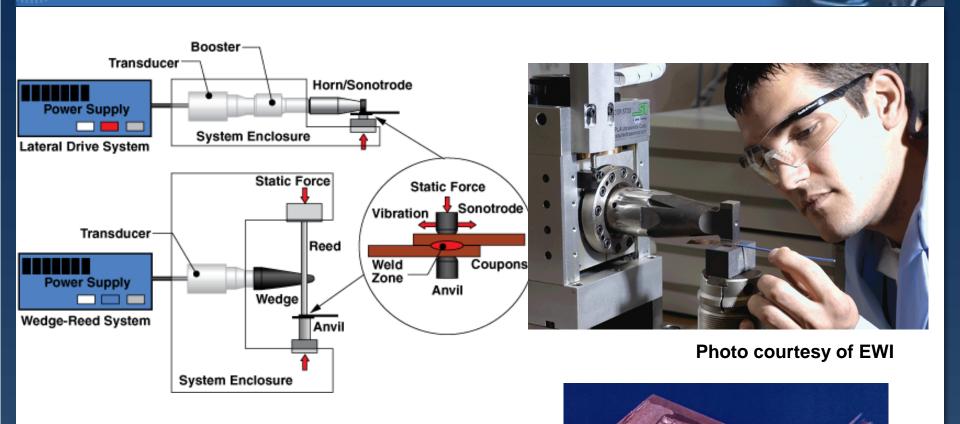



Voltec Battery Joints





Four parts (three cell tabs and a common bus) per joint, three interfaces, dissimilar metals: aluminum and copper.

Each battery = 200 welds, multiple automated welding stations, high production rate.

Each interface has to be good!




Novel NDE Techniques Developed In-House


- Active and Passive Flash Thermography NDE
- Shearographic NDE with Vibration Excitation
 - Automated "pick test";
 - Good in finding concealed defects; can detect the extend of weld fused area
- High-precision electrical resistance NDE:
 - Tests functionality of the weld and its strength
 - A large number of welds can be measured quickly (~0.2 sec per measurement) and conveniently with one fixture




Flash Thermography NDE

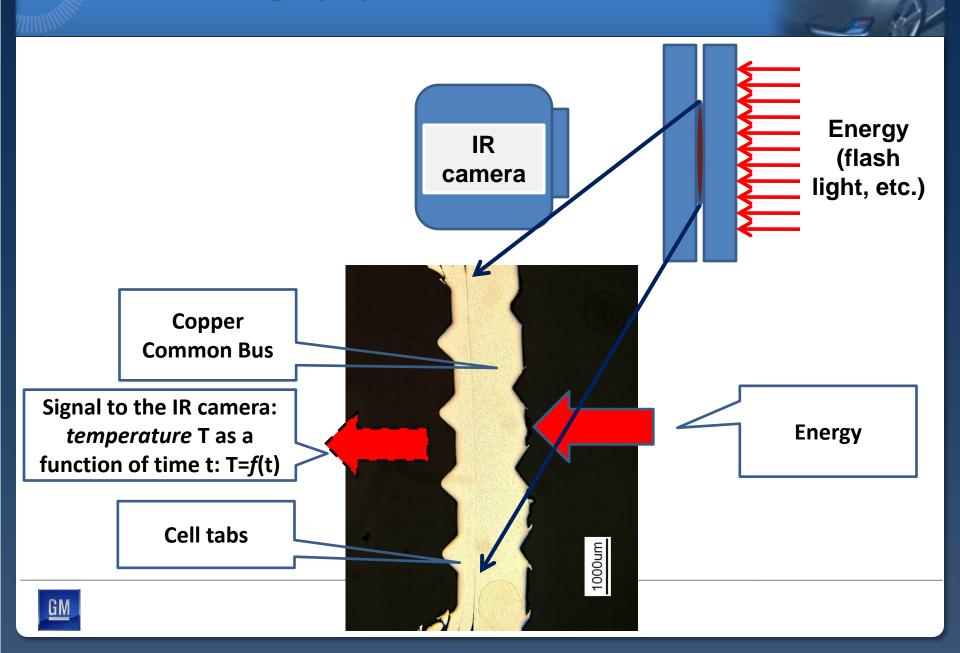

Thermal model

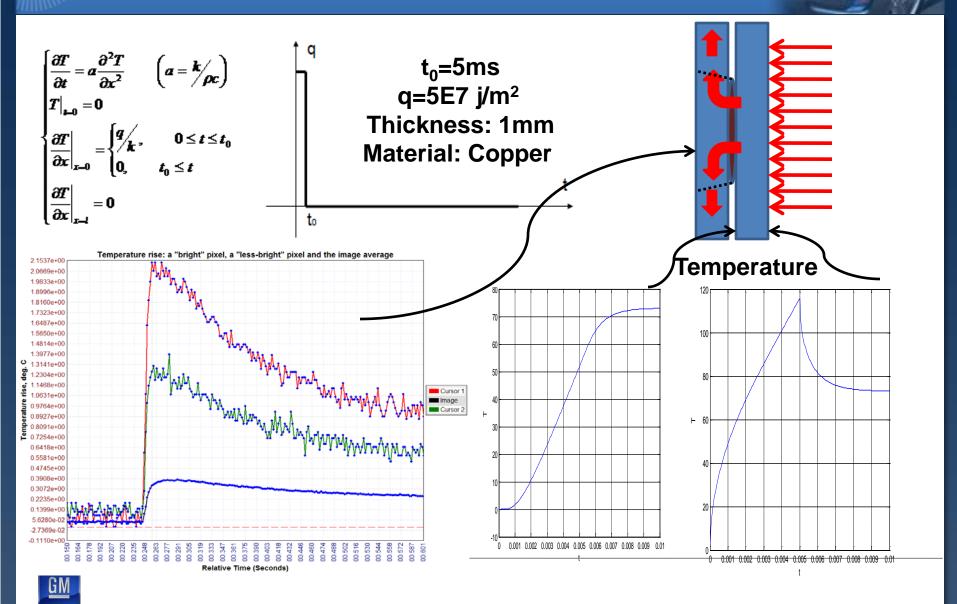

How to detect the fused area

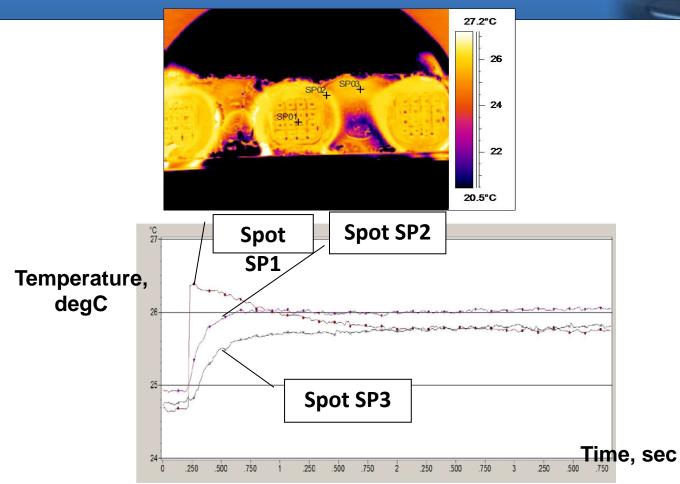

The temperature rise is more rapid in the fused area.





Results of differentiation with regard to time dT/dt dC dT/dt Time, sec dT/dt Time, sec Time, sec .750


Post-processing: differentiating with respect to time in each point (pixel) to find total fused area.




Weld strength correlates with the size of the "nugget" ...unless the joint fails elsewhere

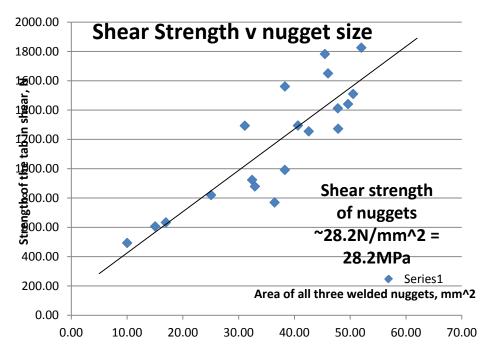

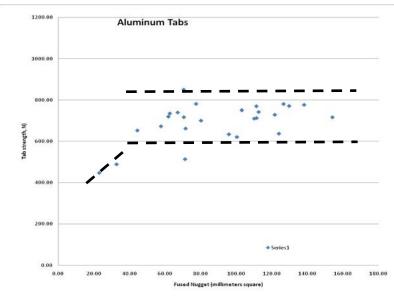


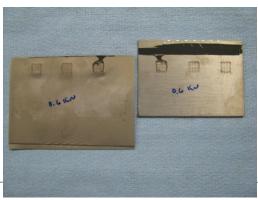

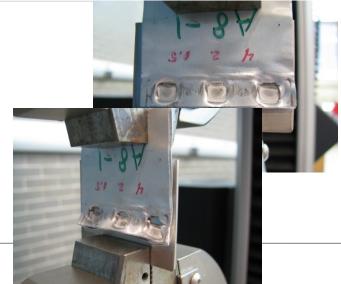




What is a shearographic camera?

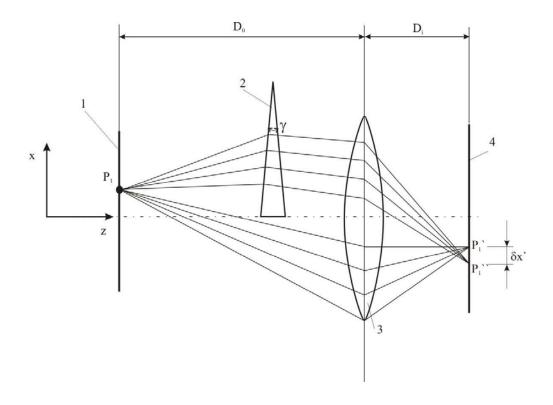



Formation of a shearographic pattern

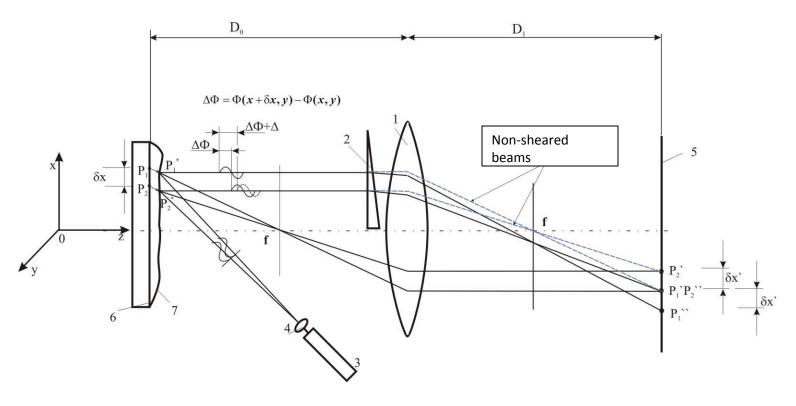


Two superimposed images are formed: a *sheared* image(s) of the object and the superimposed image of the fringes containing information about surface strains.



Shearography-based NDE with vibration excitation

TAIL BY

When vibration is applied to an assembly, a pattern of (elastic) strains forms around the weld

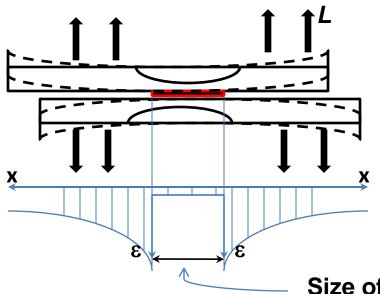

A schematic of a spot weld, loaded with loads *L*

Pattern of strains ε (generally, a 3D field, becomes 2D on the surface)


Size of the weld nugget

Image recognition is used to detect weld defects.


FEM model is used to determine the size of the fused area from the strain pattern ("inverse problem").



Sample with three welds, illuminated by a laser

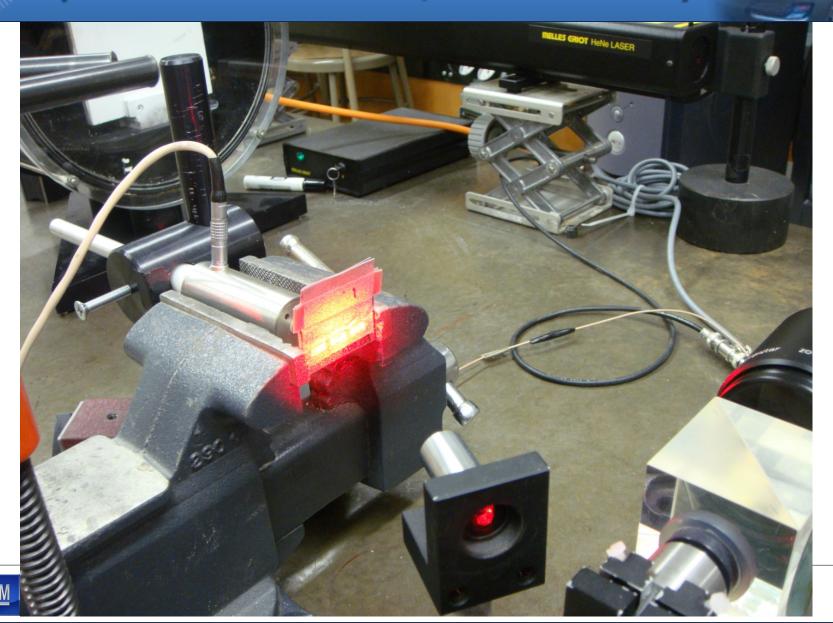


Good weld. Excitation frequency is 9.3KHz

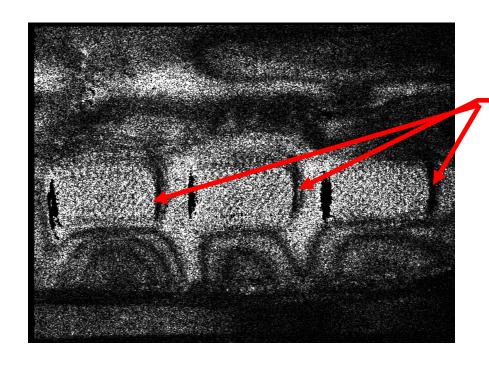

3 good welds.




Defective weld. Excitation frequency is 2.5KHz

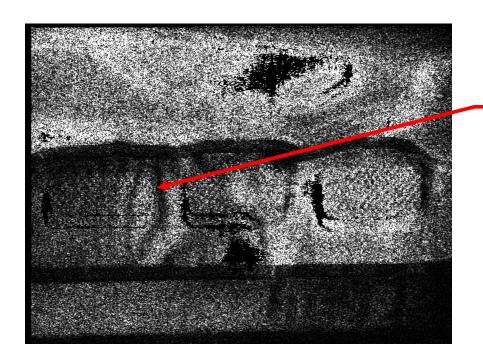

No weld nugget



Defective weld. Excitation frequency is 5KHz

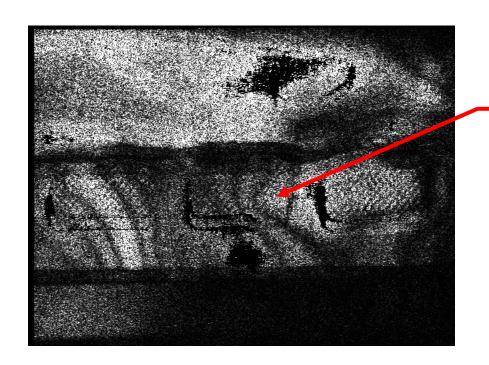

Partial weld



High-precision electrical resistance NDE


Electrical Resistance R and Strength S of a Weld:


- •area A
- •Resistivity ρ
- •Interface "length" L
- •Interface ultimate strength σ_u

$$S = \sigma_u A$$


$$R = \rho \frac{L}{A}$$


Therefore : $S \propto R^{-1}$

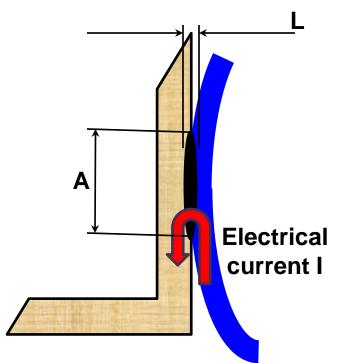

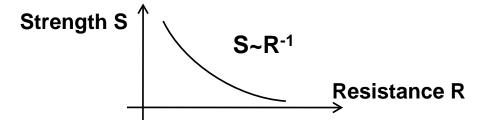

The real weld is more complicated...

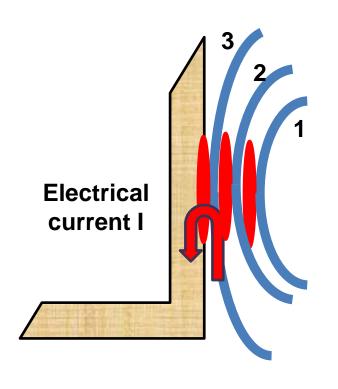

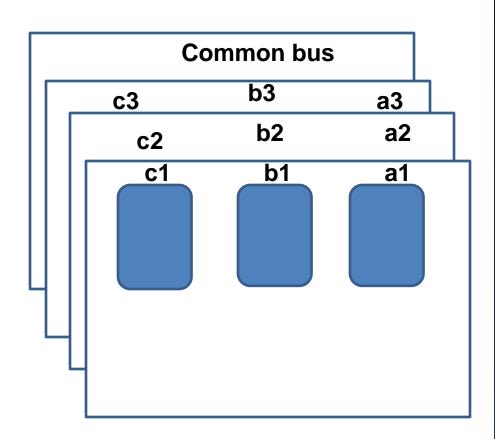




Correlation: Strength v Resistance


Strength testing of welded samples



Tearing through the weld

Shear strength v El. resist.,

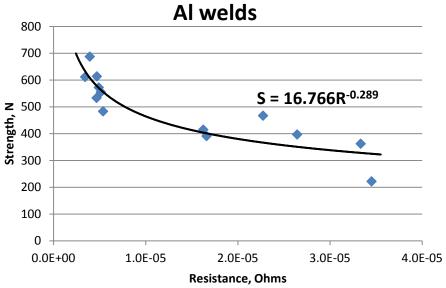

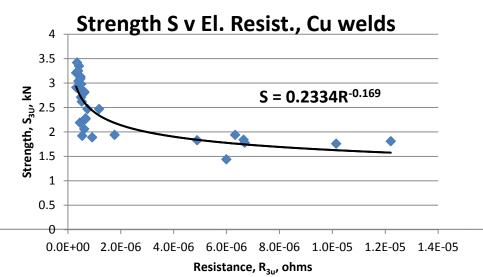



Comparison of the developed NDE methods

| Method | Advantages | Disadvantages |
|-------------------------------------|--|---|
| Thermography | The only method to measure the size of the fused area of multi-ply welds Non-contact | Requires high-power energy input → needs protection on production floor. |
| Shearography | Measures the true extent of a fused area; may uncover concealed defects | Requires: •high-resolution shearographic cameras •sophisticated image analysis and software |
| Precision Electrical Resistance NDE | Measures the main functional parameter of the weld. Can monitor welds throughout the battery life. | Requires contact fixture; needs a reliable contact with joints |



Automotive NDE Needs

Traditional NDE areas:

- NDE of safety-critical lightweight automotive components
- NDE of welding and joining
- NDE of adhesive joints
- NDE of spot welds (in selective applications)

New NDE applications:

- NDE of Li-ion batteries and cells, in production and throughout the life
- Inexpensive NDE methods for composite materials
- NDE of joints of dissimilar materials, composites
- Life monitoring of composite structures.

Production process control





THANK YOU FOR YOUR ATTENTION!



BACKUP SLIDES





Automotive NDE Needs

Traditional NDE areas:

- NDE of safety-critical lightweight automotive components
- NDE of welding and joining, particular of dissimilar materials and composites
- NDE of adhesive joints

New NDE applications:

 
- NDE of Li-ion batteries and cells, in production and throughout the life
- Inexpensive NDE methods for composite materials
 - Infrared, shearography, vibro-thermography, x-ray, CT, ultrasonic, eddy current;
 combination, new NDE techniques
- Life monitoring of composite structures.
 - Fluorescent dyes/penetrants
 - Electrical methods

Process control in production



High-precision electrical resistance NDE


The electrical resistance of the weld depends on how the current is applied.





$$S = \sigma_{u}A$$

$$R = \rho \frac{L}{A}$$

  Therefore : $S \propto R^{-1}$






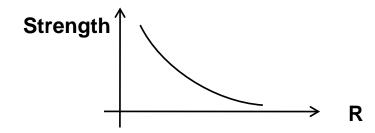




Explanation of lower power

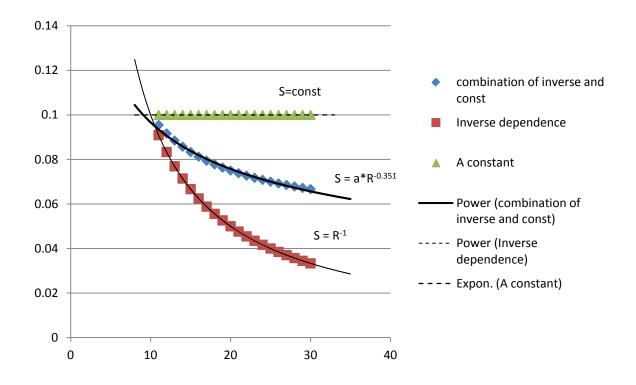



The signal can be digitized (made 0 or 1) and counted

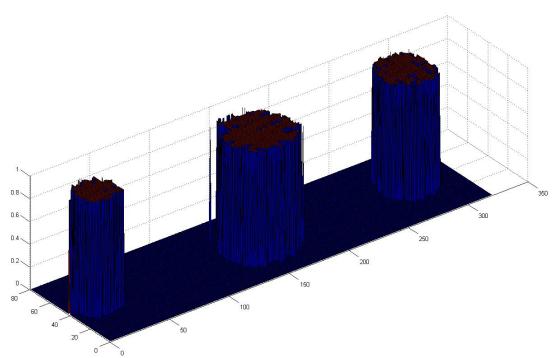

- Done with Matlab
- Each pixel is a square with dimensions (approximately):
 - $100 \mu \text{ X } 100 \mu$, with area A= 10^{-2} mm^2





...but heat can be applied one joint at a time

